

## Quick Guide Bluetooth Music Receiver WM-BT46

### Compatible with the following models:

- **Toyota**

Auris (E180) from year 2012, Avensis (T27) from year 2011-2017, Aygo from year 2014 to 2018, Corolla (E160/E170) from year 2013 to 2017, GT86 from year 2012, Prius (ZVW30) from year 2012 to 2016, Land Cruiser (J20) from year 2012 to 2015, RAV4 from year 2013 to 2016, Hilux (N25/N2) from year 2012 to 2015 Verso from year 2013, Yaris (XP13) from year 2014


- **Subaru**

Subaru BRZ from year 2012, Subaru Crosstrek from year 2011 to 2018, Subaru Forester (SJ) from year 2012, Subaru Impreza from year 2011, Subaru Levorg from year 2014, Subaru Legacy (BN/BS) from year 2014, Subaru Outback (BS) from year 2015, Subaru WRX STi from year 2014, Subaru XV from year 2011-2018

### Connecting the adapter:

1. remove the radio (you will find various instructions on the Internet).
2. Before you disconnect the plugs from the radio, make sure that you have the radio code available to you, as you may need it for the radio after the power interruption.
3. Insert the 16 pole extender of the WM-BT31 into the provided connector behind the radio.
4. Now connect the black ground cable to the radio housing or the black cable directly to a ground cable to the radio connection (usually a thick brown cable). Without a good ground connection the function of the adapter is not given.
5. Now connect the red cable (ignition plus +12V) to a switched +12V line (measurement with multimeter necessary). Ignition on = +12V on / ignition off = 0V on.

16 = Ground Aux GNE  
 15 = Entrance Aux-R  
 17 = Entrance Aux-L  
 4 = Bridge  
 18 = Bridge

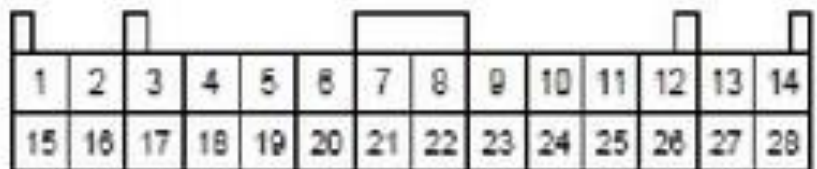

6. Establish a Bluetooth connection by enabling Bluetooth pairing and searching for the Bluetooth device "WM". You should then set the volume on the connected device to full volume.
7. Before reinstalling the radio, test the function of the adapter. Switch on the AUX function using the CD/AUX button or the menu on the radio.

**Zur Info!**

AUX muss im Radio freigeschaltet und auswählbar sein. Ist dies nicht der Fall, ist die Freischaltung in einer Fachwerkstatt erforderlich.

Has something been left unclear? You can reach us MO-FR by mail: [service@watermark-germany.de](mailto:service@watermark-germany.de)