

Quick Start Guide Bluetooth Music Receiver WM-BTMIC41

Compatible with the following models:

- OPEL Agila A from 2004 onwards
- OPEL Antara from 2006 onwards
- OPEL Astra H from 2004 onwards
- OPEL Combo C from 2004 onwards
- OPEL Corsa C from 2004 onwards
- OPEL Corsa D from 2006 onwards
- OPEL Meriva A from 2005 onwards
- OPEL Movano A from 2006 onwards
- OPEL Signum from 2003 onwards
- OPEL Tigra TwinTop from 2005 onwards
- OPEL Vectra C from 2005 onwards
- OPEL Vivaro from 2006 onwards
- OPEL Zafira B from 2005 onwards

In combination with the following original radios:


- CD70 Navi (with AUX preparation)

Not compatible with the following models/radios:

- CD30
- CD30 MP3
- CD60
- CDC40
- CDC40 Opera
- DVD90 Navi

Connecting the adapter:

1. Remove the radio (you will find various instructions on the Internet).
2. Before disconnecting the plugs from the radio, make sure that the radio code is available to you, as you will need it for the radio after the power cut..
3. Disconnect the Quadlock plug from the radio.
4. Plug the WM-BTMIC41 between the vehicle wiring harness and the original radio.

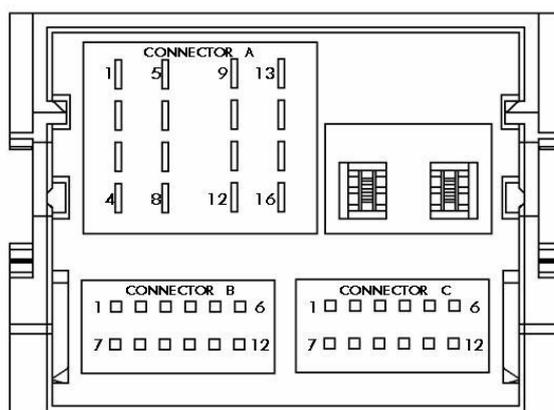

5. Now connect the red cable (ignition plus +12V) to a switched +12V cable. Since this cable is no longer available behind the radio, the voltage can be taken from the cigarette lighter, the fuse box (terminal 15) or the air conditioner (measurement with multimeter necessary). Ignition on = +12V present / ignition off = 0V present.
6. Place the microphone near the driver in the vehicle (steering wheel cover, dashboard, etc.). The cable is then routed to the Bluetooth adapter and connected to the microphone input.
Avoid placing the microphone in the direct area of or on airbags.
7. Establish a Bluetooth connection by enabling Bluetooth pairing and searching for the Bluetooth device ``WM``.
You should then set the volume on the connected mobile device to maximum.
8. Before reinstalling the radio, test the function of the adapter.
Switch on the AUX function via the CD/AUX button or the menu on the radio.

Important information!

Please make sure that the AUX function is enabled. You must be able to select AUX on the radio. If this is not the case, it is necessary to activate it in an OPEL workshop. But for this the AUX preparation must be available! (see pin assignment on radio).

Anything unclear? You can contact us MO-FR, from 8-17 o'clock
under the e-mail: service@watermark-germany.de